


MultiAir 2000

High pressure blower

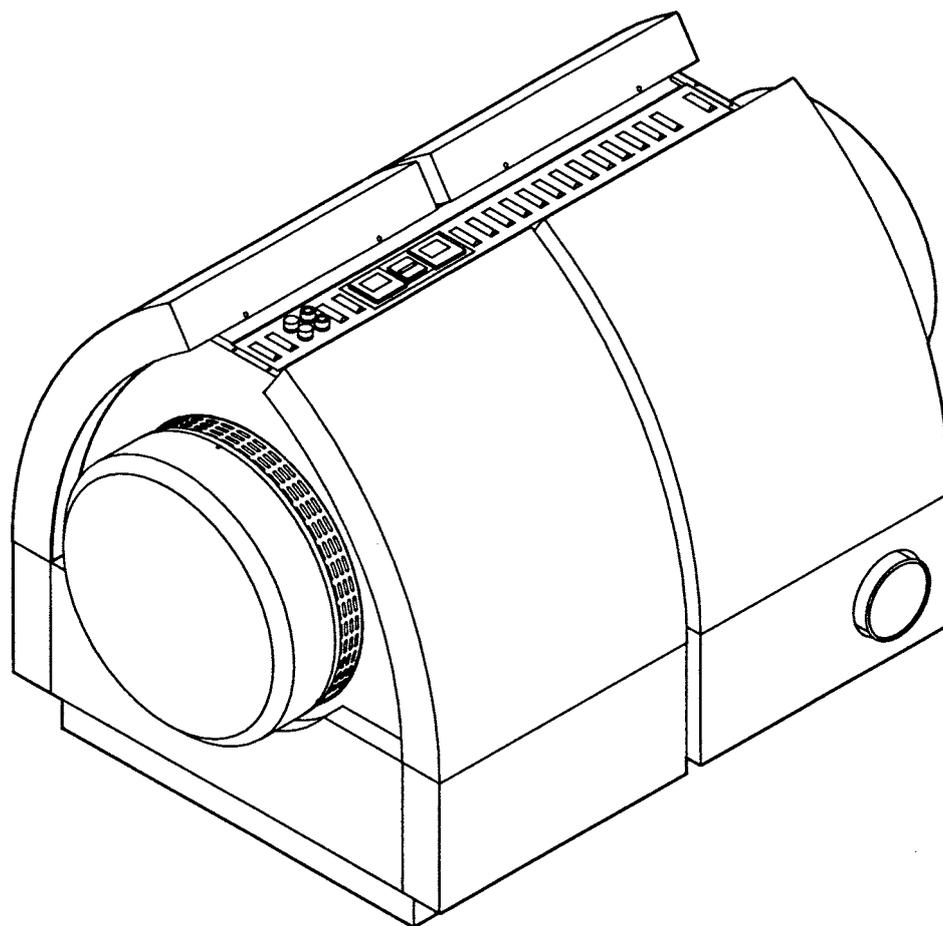

Spare parts list

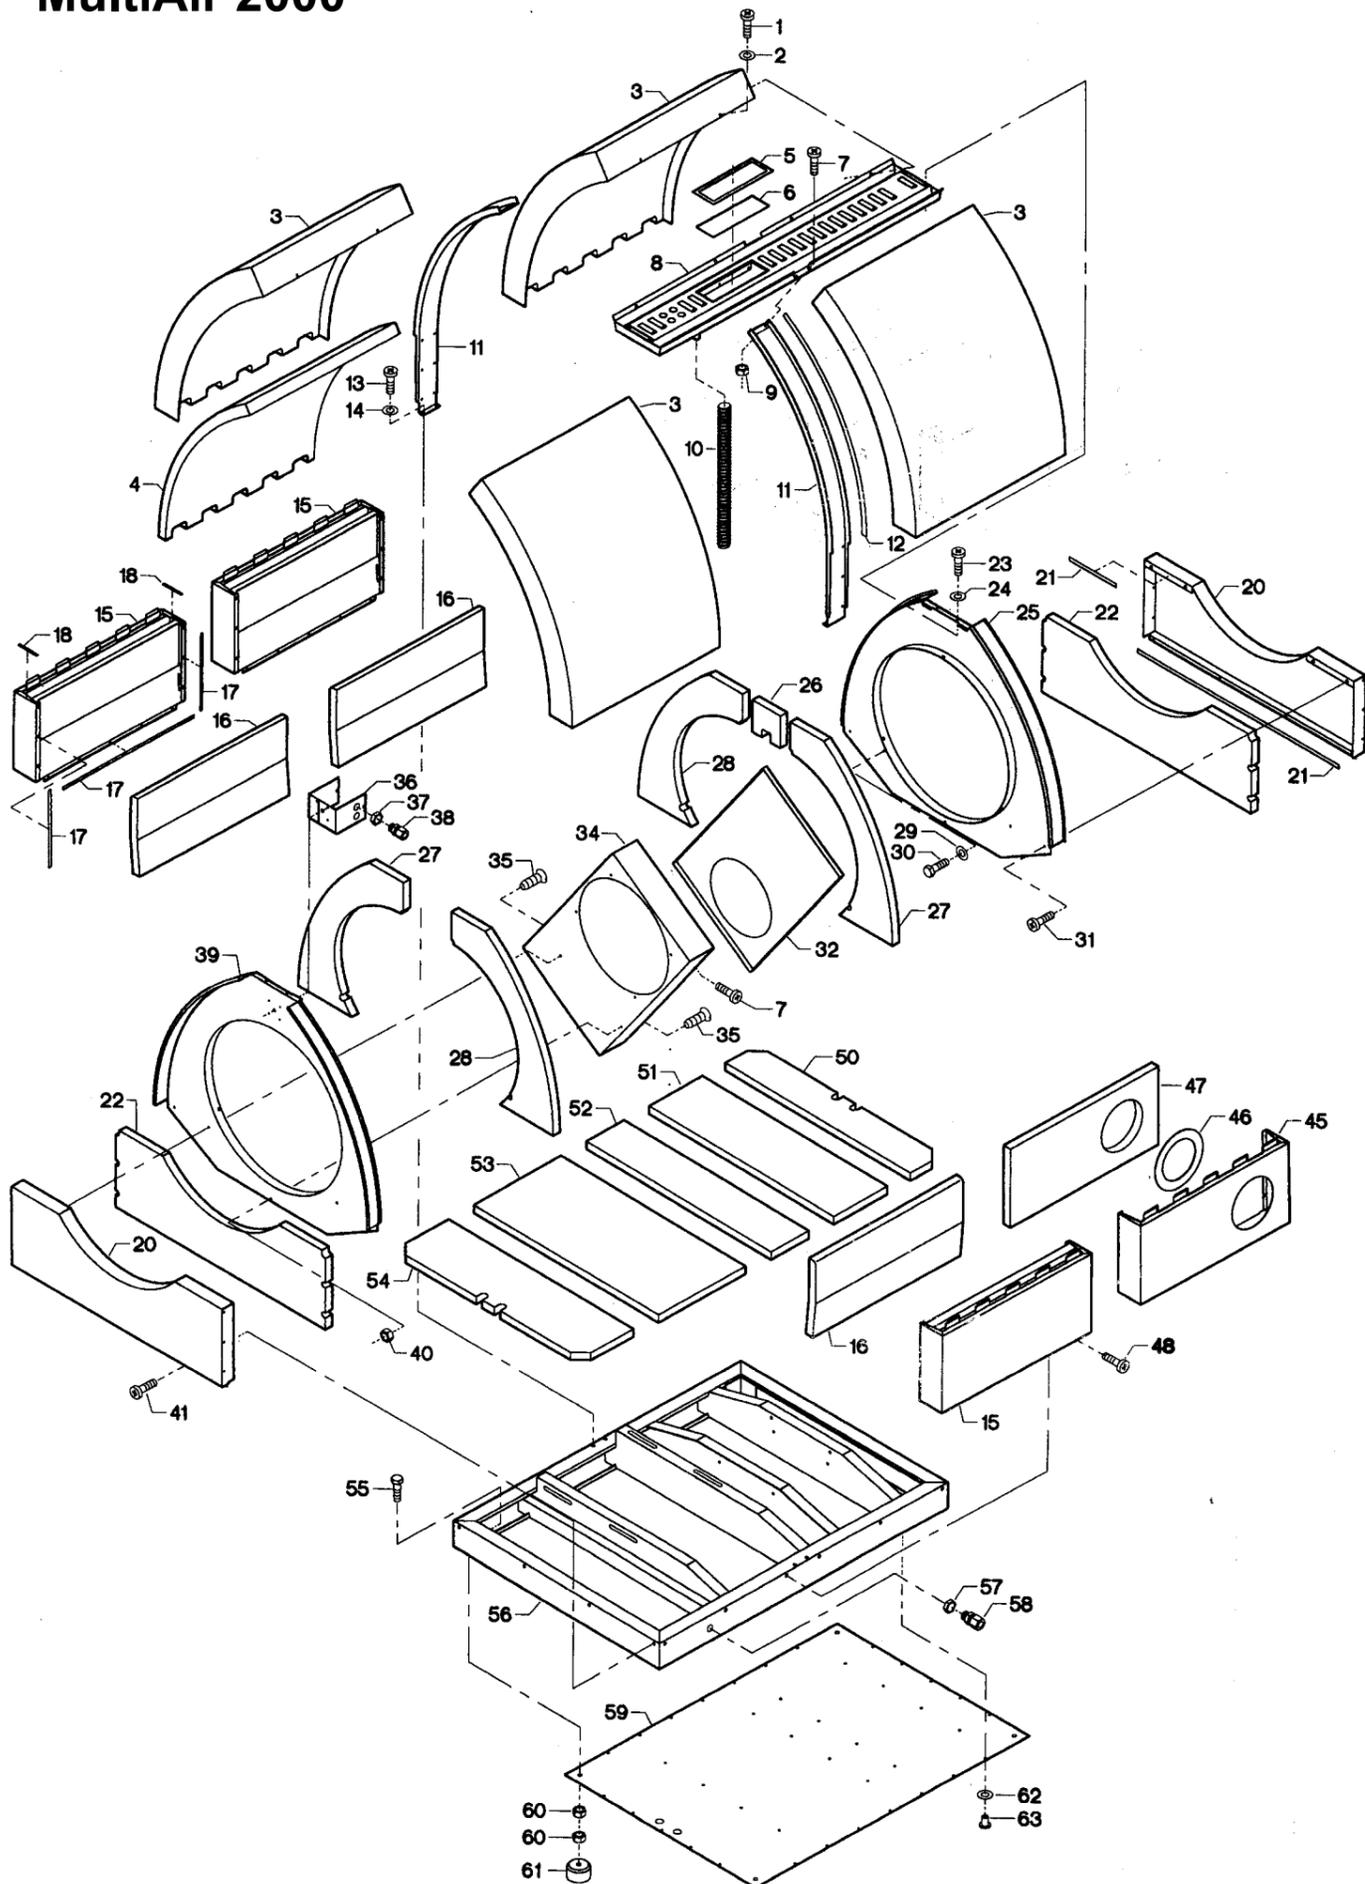


Fig.	Part no.	Pieces	Notes
1	100 350 038	8	Crosshead screw M6 x 16 mm
2	100 350 027	8	Flat washer M6
Cpl:	123 000 130	4	Incl. item 4
4	123 000 081	1	
5	123 000 123	1	
6	123 000 084	1	Crosshead screw M6 x 12 mm
7	100 321 014	8	
8	123 000 088	1	
9	100 316 002	4	Lock nut M6
10	123 020 037	2	
11	123 000 085	2	
12	100 203 097	-	Order 3 m
13	100 323 041	4	Set screw M6 x 16 mm
14	100 331 004	4	Flat washer
Cpl:	123 000 135	1	Complete incl. items 15 - 16 - 17 - 18
16	123 000 074	1	
17	100 203 030	-	
18	100 203 095	-	
Cpl:	123 000 021	2	Complete incl. items 20 - 22
21	100 202 011	-	7 x 8 mm.
22	123 000 076	1	
23	100 350 038	4	Crosshead screw M6 x 16 mm
24	100 350 027	4	Flat washer M6
Cpl:	123 000 020	2	Complete incl. items 25 - 28
26	123 000 443	1	
27	123 000 078	1	
28	123 000 077	1	
29	100 331 004	1	Flat washer M6
30	100 323 041	1	Set screw M6 x 16 mm
31	100 321 015	7	Crosshead screw M6 x 16 mm
32	123 000 225	1	For Multiair 2100 50 Hz, 2200 60 Hz
	123 000 224	1	For Multiair 2150 - 2200 - 2250 50 Hz, 2150 60 Hz
34	123 020 136	1	For Multiair 2250 - 2300 60 Hz
	123 000 223	1	For Multiair 2100 - 2150 - 2200 - 2250 50 Hz, 2150 - 2200 60 Hz
	123 020 135	1	For Multiair 2250 - 2300 60 Hz
35	100 323 146	4	Posi-drive M4.8 x 13 mm
30	123 000 232	2	
36	123 020 036	1	
37	100 511 087	2	
38	100 511 025	2	
Cpl:	123 000 439	1	Complete incl. items 27 - 28 + 39
40	100 316 002	1	Lock nut M6
41	100 321 015	8	Crosshead screw M6 x 15/16 mm
Cpl:	123 000 136	1	Complete incl. items 17 - 18 + 45 - 47
46	123 000 107	1	
47	123 000 079	1	
48	100 321 015	36	Crosshead screw M6 x 16 mm
50	123 000 073	1	
51	123 000 169	1	
52	123 000 170	1	
53	123 000 171	1	
54	123 000 172	1	
55	100 308 037	4	Steel set screw M10 x 40 mm
Cpl:	123 000 153	1	Complete incl. items 50 - 56 + 59 - 63
57	100 511 087	1	
58	100 511 025	1	
59	123 000 168	1	
60	100 315 013	8	Nut M10
61	100 323 329	4	ADM 5035
62	100 331 048	40	Flat washer M4
63	100 334 014	40	Turbular rivet

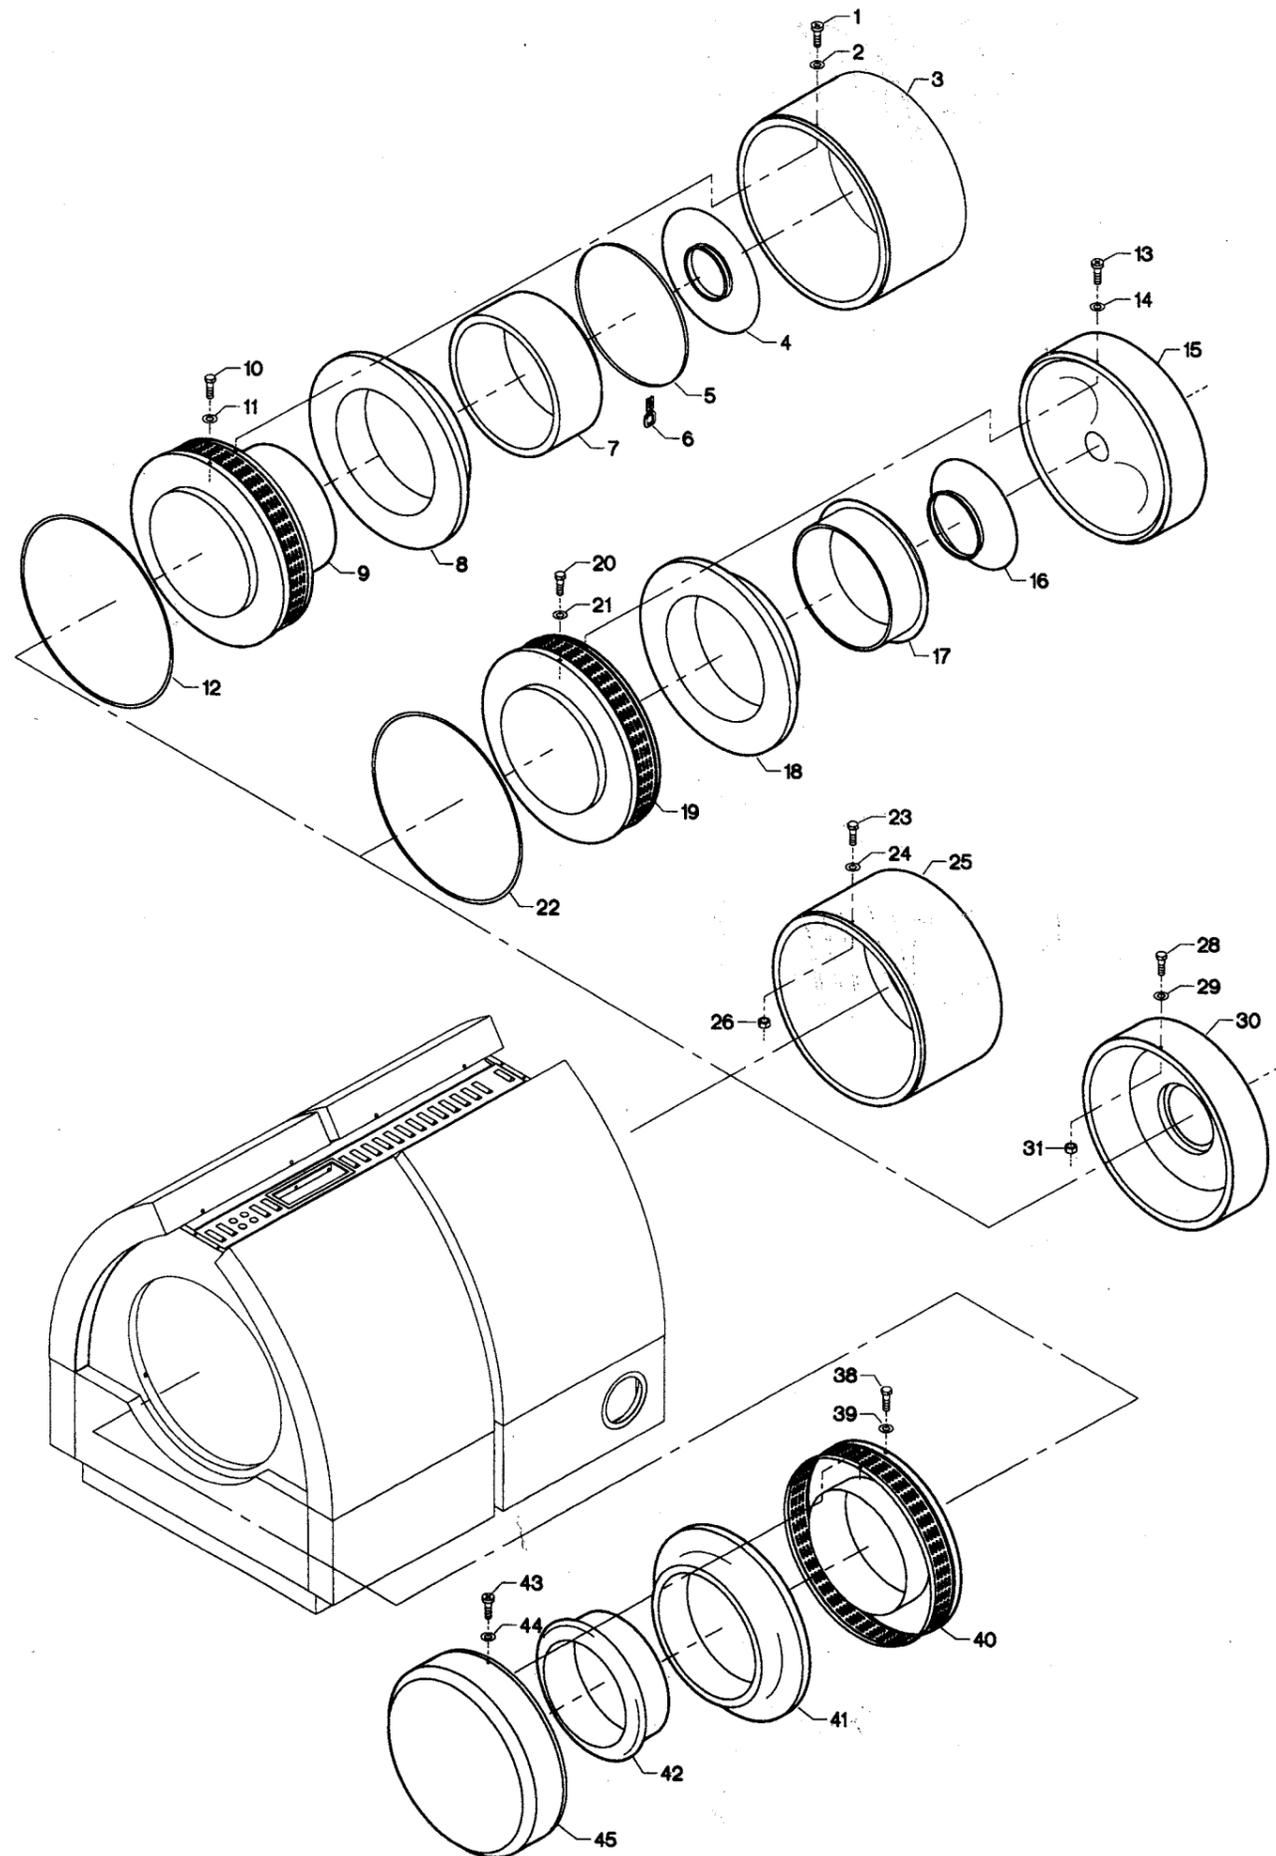


Fig.	Part no.	Pieces	Notes
1	100 350 038	3	Crosshead screw M6 x 16 mm
2	100 350 027	3	Flat washer M6
3	123 000 111	1	For Multiair TR
4	123 000 059	1	For Multiair TR
5	100 422 010	-	
6	100 422 011	2	
7	123 000 069	1	
8	123 000 065	1	
Cpl	123 000 118	1	Complete incl. items 7 - 9, for Multiair TR
10	100 308 018	3	Steel set screw M6 x 12 mm
11	100 331 004	3	Flat washer M6
12	100 203 030	-	
13	100 350 038	3	Crosshead screw M6 x 16 mm
14	100 350 027	3	Flat washer M6
15	123 000 112	1	For Multiair T
16	123 000 060	1	For Multiair T
17	123 000 066	1	
18	123 000 065	1	
Cpl	123 000 117	1	Complete incl. items 17 - 19, for Multiair T
20	100 308 018	3	Set screw M6 x 12 mm
21	100 331 004	3	Flat washer M6
22	100 203 030	-	
23	100 308 018	3	Set screw M6 x 12 mm
24	100 331 004	3	Flat washer M6
25	123 000 113	1	For Multiair SR
26	100 316 075	3	Flange nut M6
28	100 308 018	3	Set screw M6 x 12 mm
29	100 331 004	3	Flat washer M6
30	123 000 114	1	For Multiair S
31	100 316 075	3	Flange nut M6
38	100 308 018	3	Set screw M6 x 12 mm
39	100 331 004	3	Flat washer M6
41	123 000 065	1	
42	123 000 066	1	
Cpl	123 000 117	1	Complete incl. items 40 - 42
43	100 350 038	3	Crosshead screw M6 x 16 mm
44	100 350 027	3	Flat washer M6
45	123 000 112	1	

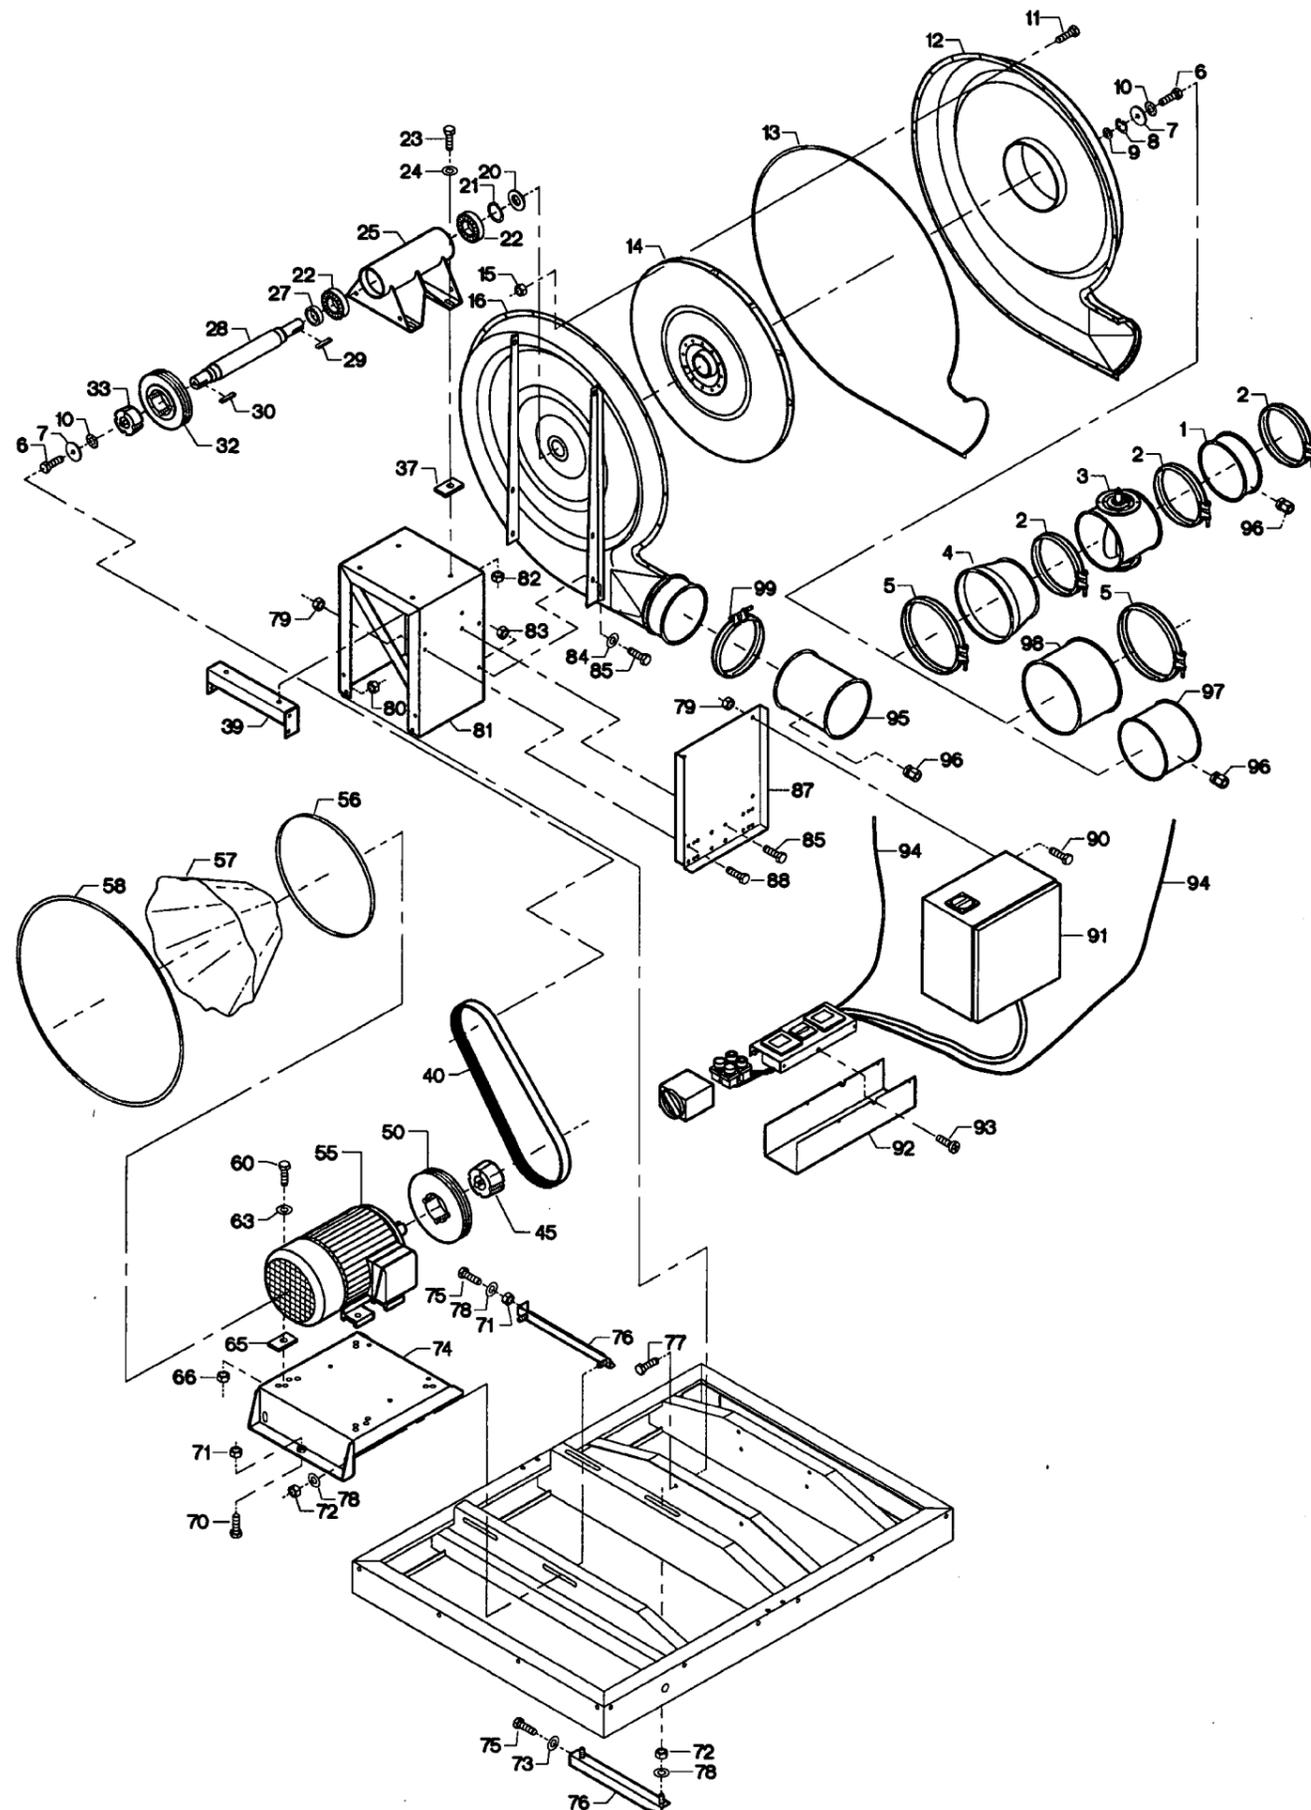


Fig.	Part no.	Pieces	Notes
1	122 010 090	1	For Multiair S with air refulator
2	122 000 599	3	Clamp with bolt OK160
3	123 000 109	1	
4	121 000 537	1	
5	122 050 110	2	Clamp with bolt OK200
6	100 306 030	2	Set screw M10 x 30 mm
7	121 000 060	2	
8	100 407 001	1	Circlip ø28 x 1.2 mm
9	121 000 027	1	Star washer M10
10	100 332 004	2	
11	100 308 018	28	Steel set screw M6 x 15 mm
12	123 000 129	1	
13	121 100 303	-	Sealing strip. Order 3.0m
14	121 090 006	1	
15	100 316 075	28	Flange nut M6
16	123 000 128	1	
20	123 020 184	1	
21	100 407 012	1	Circlip ø40 x 1.75 mm
22	100 401 072	2	Ball bearing # 6208-2RSR C3 L12
23	100 306 029	4	Steel set screw M10 x 25 mm
24	100 331 006	4	Flat washer M10
25	113 026 067	1	
27	113 026 064	1	
28	113 026 063	1	
29	100 405 015	1	Key 8 x 7 x 36 mm
30	100 405 014	1	Key 10 x 8 x 28 mm
Cpl:	121 090 044	1	Complete incl. items 21 - 22 + 25 -30
32	123 000 472	1	PL 13206T-2517, Ø132 mm
	123 000 473	1	PL 15006T-2517, Ø150 mm
	123 000 474	1	PL 16006T-2517, Ø160 mm
	123 000 475	1	PL17006T-2517, Ø170 mm
	123 000 476	1	PL15008T-2517, Ø150 mm
	123 000 477	1	PL16008T-2517, Ø160 mm
33	123 000 478	1	TB-2517-32
37	123 000 058	4	
39	123 000 466	1	6PL-1075-LB. Beltlength 1075 mm
40	100 403 221	1	6PL-1150-LB. Beltlength 1150 mm
	100 403 220	1	6PL-1194-LB. Beltlength 1194 mm
	100 403 222	1	8PL-1075-LB. Beltlength 1075 mm
	100 403 226	1	
45	100 403 227	1	8PL-1150-LB. Beltlength 1150 mm
	123 000 187	1	TB-2517-38.
	123 000 184	1	TB-2517-42.
	123 000 191	1	TB-2517-1 5/8".
50	123 000 473	1	PL 15006T-2517, Ø150 mm
	123 000 474	1	PL 16006T-2517, Ø160 mm
	123 000 475	1	PL17006T-2517, Ø170 mm
	123 000 213	1	PL18006T-2517, Ø180 mm
	123 000 253	1	PL19006T-2517, Ø190 mm
	123 000 178	1	PL20006T-2517, Ø200 mm
	123 000 179	1	PL21806T-2517, Ø218 mm
	123 000 180	1	PL22406T-2517, Ø224 mm
	123 000 476	1	PL15008T-2517, Ø150 mm
	123 000 477	1	PL16008T-2517, Ø160 mm
	123 000 396	1	PL19008T-2517, Ø190 mm
55	123 000 397	1	PL20008T-2517, Ø200 mm
	123 000 398	1	PL21808T-2517, Ø218 mm
	123 000 214	1	PL23606T-2517, Ø236 mm
	100 501 064	1	Motor 132SX2-B3-7.5 kW-400 v-50 Hz-3000 rpm.
	100 501 019	1	Motor 160M2-B3-11 kW-400 v-50 Hz-3000 rpm.
	100 501 091	1	Motor 160MX2-B3-15 kW-400 v-50 Hz-3000 rpm.
	100 501 157	1	Motor K21R-160L2-B3-18.5 kW-400 v-50 Hz-3000 rpm.
	100 551 089	1	Motor 254T-15 HP-460 v-60 Hz-3500 rpm-M2394T
	100 551 019	1	Motor 254T-15 HP-575 v-60 Hz-3500 rpm-M2394T-5
	100 551 069	1	Motor 256T-20 HP-460 v-60 Hz-3525 rpm-M4106T
	100 551 070	1	Motor 256T-20 HP-575 v-60 Hz-3525 rpm-M4106T-5
	100 551 096	1	Motor 284TS-25 HP-460 v-60 Hz-3525 rpm-M4107T
	100 551 085	1	Motor 284TS-25 HP-575 v-60 Hz-3525 rpm-M4107T-5
	100 551 030	1	Motor 286TS-30 HP-460 v-60 Hz-3525 rpm-M4108T
	100 551 020	1	Motor 286TS-30 HP-575 v-60 Hz-3525 rpm-M4108T-5
56	100 422 010	2	Cable tie 7,9 x 750mm
57	123 000 379	1	For Multiair 2100-50 Hz, 2200-60 Hz
	123 000 380	1	For Multiair 2150, 2200, 2250-50 Hz, 2150-60 Hz
	123 020 139	1	For Multiair 2250, 2300-60 Hz
58	100 203 030	3	Sealing strip 2 x 6mm, self adhesive

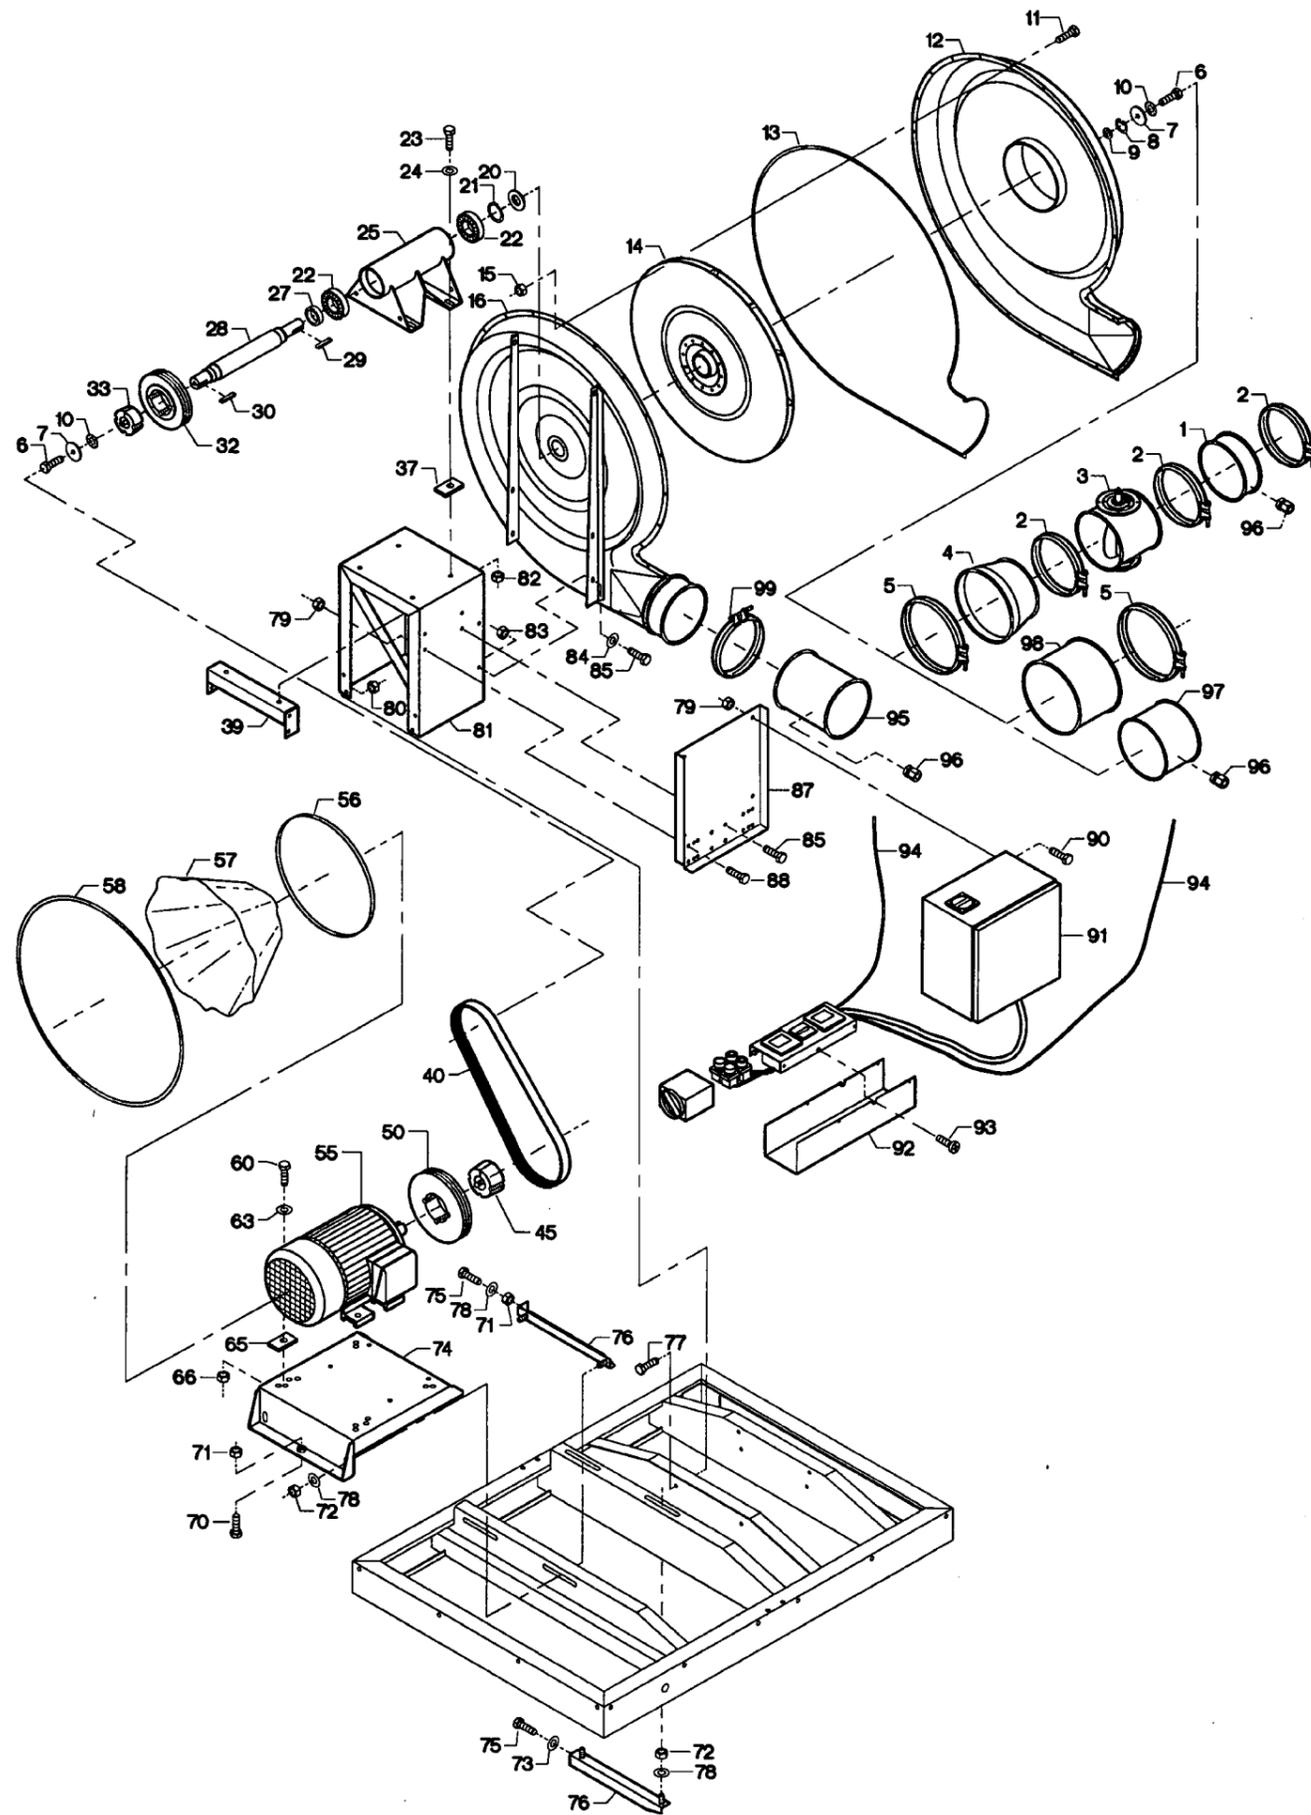


Fig.	Part no.	Pieces	Notes
60	100 306 033	4	Screw M10 x 45 mm. For Multiair 2100-50 Hz Screw M12 x 50 mm. For Multiair 2150, 2200, 2250-50 Hz Screw M12 x 55 mm. For Multiair 2150, 2200, 2250, 2300-60 Hz
	100 308 046	4	
	100 306 047	4	
	100 331 015	4	
63	100 331 015	4	Flat washer M10. For Multiair 2100-50 Hz Flat washer M12. For Multiair 2150, 2250-50 Hz, 2150, 2200, 2250, 2300-60 Hz
	100 331 016	4	
65	100 331 007	4	Flat washer M12. For Multiair 2200-50 Hz, For Multiair 2100 For Multiair 2150, 2200, 2250, 2300
	121 000 058	4	
	123 000 342	4	
	100 316 004	4	
66	100 316 004	4	Lock nut M10. For Multiair 2100 Lock nut M12. For Multiair 2150, 2200, 2300
	100 316 005	4	
70	100 304 036	1	Set screw M12 x 50 mm
71	100 315 016	2	Nut M12
72	100 316 005	4	Lock nut M12
73	100 331 007	2	Flat washer M12
74	123 000 163	1	
75	100 308 017	2	Steel bolt M12 x 130 mm
	123 000 165	2	
77	100 306 014	8	Steel set screw M8 x 15 mm
78	100 331 016	4	Flat washer M12
79	100 316 003	8	Lock nut M8
80	100 316 003	8	Lock nut M8 Lock nut M10 Lock nut M8 Flat washer M8
	123 000 160	1	
	100 316 004	4	
	100 331 005	4	
85	100 306 014	10	Steel set screw M8 x 15 mm Steel set screw M8 x 20 mm Steel set screw M8 x 15 mm For Multiair 2100-50 Hz
	123 000 049	1	
	100 306 015	2	
	100 306 014	4	
	123 000 173	1	
92	123 000 174	1	For Multiair 2150-50 Hz For Multiair 2200-50 Hz For Multiair 2250-50 Hz For Multiair 60 Hz
	123 000 175	1	
	123 000 176	1	
	123 020 038	1	
	123 000 098	1	
93	100 321 015	6	Crosshead screw M6 x 15/16 mm For Multiair T For Multiair S For Multiair T
	100 203 098	1	
	100 203 098	2	
	122 010 098	1	
	100 511 089	1	
97	100 511 089	2	For Multiair S
	122 010 104	1	
	122 050 158	1	
	122 000 599	1	

Kongskilde Industries A/S
Skælskørvej 64
DK - 4180 Sorø
Tel. +45 72 17 60 00
mail@kongskilde-industries.com
www.kongskilde-industries.com

